

# B-Series MURPHYGAGE®



## Pressure, Vacuum and Temperature

- 2 in. (51 mm) Dial Gages
- Heavy-duty Rated
- Environment Sealed\*
- Pressure Models Up to 400 psi (2.76 MPa) [27.6 bar]
- Temperature Models Up to 440°F (220°C)



### Description

The B-Series MURPHYGAGE® is a high quality, diaphragm-actuated indicating gage. Built by Murphy with the same heavy-duty design as the standard 20 series and 25 series SWICHGAGE®, the B-gage is more compact and is the optimum instrument for gage-only applications. It has a high impact polycarbonate lens, sturdy steel case, and a polished, low-profile stainless steel bezel. Accuracy and protection from moderate over-pressure/over-temperature are assured by a unique, unitized diaphragm chamber, superior quality materials, and the design of the gage movement.

#### Pressure MURPHYGAGE®

Pressure changes at the diaphragm convert to accurate mechanical movements that are indicated on an easy to read analog dial. A pulsation dampener in the pressure port helps eliminate pointer flutter; it can be removed for cleaning to maintain the MURPHYGAGE® response and accuracy.

#### Vacuum MURPHYGAGE®

Operating like the pressure MURPHYGAGE®, the vacuum instrument is available in 0 to 20 or 0 to 30 in. Hg. (0 to -68 or 0 to -102 kPa) vacuum.

#### Temperature MURPHYGAGE®

The temperature MURPHYGAGE® operates on the same mechanical principle as the pressure instrument. As temperature rises, the fluid in the sensing bulb vaporizes to apply pressure on the diaphragm; the movement translates this vapor pressure to a calibrated reading of temperature on the dial. The standard capillary is copper with a PVC armor. Optional armor covering is galvanized steel or 316 stainless steel (specify). Optional bulb types, adaptor nuts and thermowells are available.†

### Applications

Industrial engines and equipment in Oil Field, Marine, Irrigation, Construction and Trucking industries. Monitoring Engine Coolant, Crankcase Oil, Transmission Oil.

### Specifications

**Dial:** White on black; U.S.A. standard scale is dual scale; others available (see How to Order).

#### Gage Accuracy:

##### Pressure/Vacuum (% of Full Scale):

RANGE	LOWER 1/4	MIDDLE 1/2	UPPER 1/4
≤300 psi (24 Bar)	±3%	±2%	±3%
400 psi (28 Bar)	±3%	±3%	±5%

**Temperature:** See chart on reverse side.

#### Temperature Range:

##### Pressure/Vacuum:

Ambient: -40°F (-40°C) thru 150°F (66°C).

Process: -40°F (-40°C) thru 250°F (121°C).

**Temperature:** See chart on reverse side.

**Maximum Panel Thickness:** 1/4 in. (6 mm).

**Port:** Brass.

**Case:** Plated steel; mounting clamp included (except for direct mount models).

**Bezel:** Polished stainless steel, standard; optional bezels are available (see How to Order).

**Pointer:** White (black dial); black (white dial).


**Lens:** Polycarbonate, high-impact.

**Sensing Element:** Beryllium copper diaphragm.

### Comparison of a MURPHYGAGE® to Most Other Gages

The basic difference between the MURPHYGAGE® and most other gages is the internal design. The MURPHYGAGE® does not rely on the gage case to serve as part of the sensing chamber. The diaphragm (A) which must expand and contract consistently with changing pressures and temperatures, is held firmly in place by the back plate (B) and the mounting plate (C). In most other gages the diaphragm (D) and an expansion retarding plate (E) are soldered directly into the case port and held in place by a locator ring (F). Should the case receive any damage

in this area the diaphragm operation could be affected. However, in the MURPHYGAGE®, the diaphragm is protected and securely locked in position. Another feature of the MURPHYGAGE® is the removable pulsation dampener (pressure instruments only) (G) which provides for periodic cleaning when being used with liquids which might cause clogging. Other gages are usually equipped with a non-removable dampener (H).

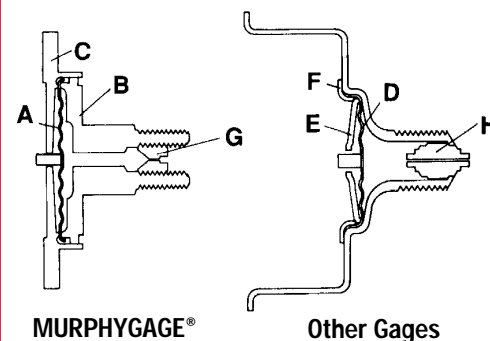

### Warranty


A two-year limited warranty on materials and workmanship is given with this Murphy product. Details are available on request and are packed with each unit.

\* All pressure gages, above 30 psi (200 kPa) [20.0 bar] and all temperature gages, are environmentally sealed and filled with inert gas. This seal protects the mechanism and eliminates "clouding" of the lens from moisture condensation.

\*\* Products covered by this bulletin comply with EMC Council directive 89/336/EEC regarding electromagnetic compatibility except as noted.

† For optional temperature capillary lengths, engine adaptors, sensing bulbs and range combinations, see Murphy bulletin T-8428B.

## Standard Dimensions

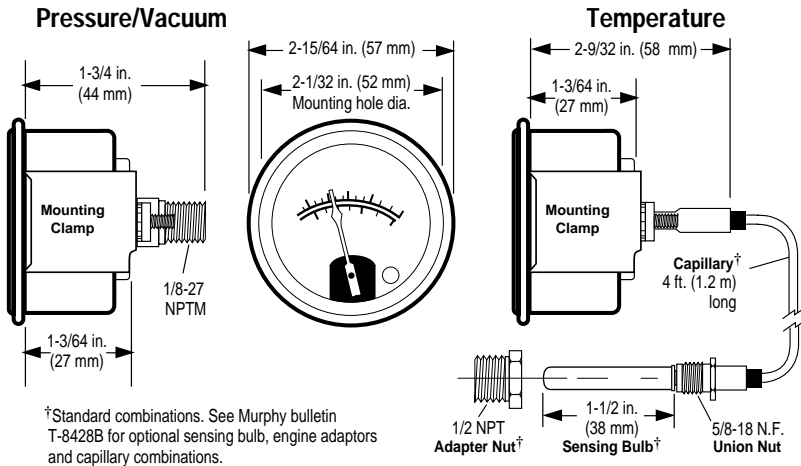

## Temperature Accuracy/Range Chart

Celsius measurements are shown in parenthesis.

RANGE	Lower 1/3 Scale	Middle 1/3	Upper 1/3
32-120 (0-49)	± 12° (± 6)	± 5° (± 2.4°)	± 6° (± 3°)
32-160 (0-71)	± 20° (± 10°)	± 8° (± 4.4°)	± 7° (± 4°)
130-220 (54-104)	± 6°F (± 3°)	± 3° (± 1.6°)	± 4° (± 2°)
130-250 (54-121)	± 9° (± 5°)	± 5° (± 2.4°)	± 4° (± 2°)
140-300 (60-149)	± 10° (± 5.2°)	± 6° (± 3°)	± 5° (± 2.4°)
160-320 (71-160)	± 10° (± 5.2°)	± 5° (± 2.4°)	± 5° (± 2.4°)
180-350 (82-177)	± 12° (± 6°)	± 5° (± 2.4°)	± 5° (± 2.4°)
300-440 (149-227)	± 9° (± 5°)	± 5° (± 2.4°)	± 4° (± 2°)

### MAXIMUM PROCESS TEMPERATURE

RANGE	MAXIMUM PROCESS TEMPERATURE
≤250° (120°)	120% OF FULL SCALE
300° (140°)	350° (198°)
≥320° (160°)	120% OF FULL SCALE

## How to Order

To order, use the diagram below. **NOTE:** List options in ascending alphabetical order (A-Z). Example: **20BTG-IP1-250-4**

<b>Base Model</b> 20BPG = Pressure 20BVG = Vacuum 20BTG = Temperature	<b>Options*</b> B1 = Black bezel B2 = Bezel 05051857 (was "HP") B3 = Bezel 05051836 (was "HBB") D = Direct mount IP1 = Light pipe illumination, 12 VDC IP2 = Light pipe illumination, 24 VDC *Options not available on all models or configurations.	<b>Temperature Capillary Armor Type and Length</b> <b>Capillary Armor Type</b> Blank = PVC armor, copper capillary S = Stainless steel armor, copper capillary <b>Capillary Length (specify after capillary type; example: "S4")</b> 4 = 4 ft. (1.2 m) Specify other length = Available in 2 ft. increments thru 20 ft.; 5 ft. increments above 20 ft. (0.5 metre increments from 1.5–10 metres; 2 metre increments thru 34 metres. Specify "M" following length, i.e. 1.5M.)																																																																																		
<b>Range††</b> <table border="1"> <thead> <tr> <th>Pressure (20BPG) Dual scale (psi/kPa)</th> <th>Pressure (20BPG) Single scale (bar)</th> <th>Vacuum (20BVG) Dual scale (in. Hg/kPa)</th> <th>Temperature (20BTG) Dual scale (°F/°C)</th> <th>Temperature (20BTG) Single scale (°C)</th> </tr> </thead> <tbody> <tr> <td> <table border="1"> <tr><th>psi</th><th>kPa/MPa</th></tr> <tr><td>15</td><td>= 0-15 0-103</td></tr> <tr><td>30</td><td>= 0-30 0-207</td></tr> <tr><td>50</td><td>= 0-50 0-345</td></tr> <tr><td>75</td><td>= 0-75 0-517</td></tr> <tr><td>100</td><td>= 0-100 0-689</td></tr> <tr><td>150</td><td>= 0-150 0-1.03</td></tr> <tr><td>200</td><td>= 0-200 0-1.38</td></tr> <tr><td>300</td><td>= 0-300 0-2.07</td></tr> <tr><td>400</td><td>= 0-400 0-2.76</td></tr> </table> </td> <td> <table border="1"> <tr><th>1B</th><td>= 0-1 bar</td></tr> <tr><th>2B</th><td>= 0-2 bar</td></tr> <tr><th>3.5B</th><td>= 0-3.5 bar</td></tr> <tr><th>5B</th><td>= 0-5 bar</td></tr> <tr><th>7B</th><td>= 0-7 bar</td></tr> <tr><th>10B</th><td>= 0-10 bar</td></tr> <tr><th>14B</th><td>= 0-14 bar</td></tr> <tr><th>20B</th><td>= 0-20 bar</td></tr> <tr><th>28B</th><td>= 0-28 bar</td></tr> </table> </td> <td> <table border="1"> <tr><th>in. Hg</th><th>kPa</th></tr> <tr><td>20</td><td>= 0 to 20 0 to -68</td></tr> <tr><td>30</td><td>= 0 to 30 0 to -102</td></tr> </table> </td> <td> <table border="1"> <tr><th>°F</th><th>°C</th></tr> <tr><td>120</td><td>= 32-120 0-49</td></tr> <tr><td>160</td><td>= 32-160 0-71</td></tr> <tr><td>220</td><td>= 130-220 54-104</td></tr> <tr><td>250</td><td>= 130-250 60-121</td></tr> <tr><td>300</td><td>= 140-300 60-149</td></tr> <tr><td>320</td><td>= 160-320 71-160</td></tr> <tr><td>350</td><td>= 180-350 71-160</td></tr> <tr><td>440</td><td>= 300-440 149-227</td></tr> </table> </td> <td> <table border="1"> <tr><th>70C</th><td>= 0-70°C</td></tr> <tr><th>100C</th><td>= 45-100°C</td></tr> <tr><th>120C</th><td>= 50-120°C</td></tr> <tr><th>140C</th><td>= 60-140°C</td></tr> <tr><th>160C</th><td>= 70-160°C</td></tr> </table> </td> </tr> </tbody> </table>			Pressure (20BPG) Dual scale (psi/kPa)	Pressure (20BPG) Single scale (bar)	Vacuum (20BVG) Dual scale (in. Hg/kPa)	Temperature (20BTG) Dual scale (°F/°C)	Temperature (20BTG) Single scale (°C)	<table border="1"> <tr><th>psi</th><th>kPa/MPa</th></tr> <tr><td>15</td><td>= 0-15 0-103</td></tr> <tr><td>30</td><td>= 0-30 0-207</td></tr> <tr><td>50</td><td>= 0-50 0-345</td></tr> <tr><td>75</td><td>= 0-75 0-517</td></tr> <tr><td>100</td><td>= 0-100 0-689</td></tr> <tr><td>150</td><td>= 0-150 0-1.03</td></tr> <tr><td>200</td><td>= 0-200 0-1.38</td></tr> <tr><td>300</td><td>= 0-300 0-2.07</td></tr> <tr><td>400</td><td>= 0-400 0-2.76</td></tr> </table>	psi	kPa/MPa	15	= 0-15 0-103	30	= 0-30 0-207	50	= 0-50 0-345	75	= 0-75 0-517	100	= 0-100 0-689	150	= 0-150 0-1.03	200	= 0-200 0-1.38	300	= 0-300 0-2.07	400	= 0-400 0-2.76	<table border="1"> <tr><th>1B</th><td>= 0-1 bar</td></tr> <tr><th>2B</th><td>= 0-2 bar</td></tr> <tr><th>3.5B</th><td>= 0-3.5 bar</td></tr> <tr><th>5B</th><td>= 0-5 bar</td></tr> <tr><th>7B</th><td>= 0-7 bar</td></tr> <tr><th>10B</th><td>= 0-10 bar</td></tr> <tr><th>14B</th><td>= 0-14 bar</td></tr> <tr><th>20B</th><td>= 0-20 bar</td></tr> <tr><th>28B</th><td>= 0-28 bar</td></tr> </table>	1B	= 0-1 bar	2B	= 0-2 bar	3.5B	= 0-3.5 bar	5B	= 0-5 bar	7B	= 0-7 bar	10B	= 0-10 bar	14B	= 0-14 bar	20B	= 0-20 bar	28B	= 0-28 bar	<table border="1"> <tr><th>in. Hg</th><th>kPa</th></tr> <tr><td>20</td><td>= 0 to 20 0 to -68</td></tr> <tr><td>30</td><td>= 0 to 30 0 to -102</td></tr> </table>	in. Hg	kPa	20	= 0 to 20 0 to -68	30	= 0 to 30 0 to -102	<table border="1"> <tr><th>°F</th><th>°C</th></tr> <tr><td>120</td><td>= 32-120 0-49</td></tr> <tr><td>160</td><td>= 32-160 0-71</td></tr> <tr><td>220</td><td>= 130-220 54-104</td></tr> <tr><td>250</td><td>= 130-250 60-121</td></tr> <tr><td>300</td><td>= 140-300 60-149</td></tr> <tr><td>320</td><td>= 160-320 71-160</td></tr> <tr><td>350</td><td>= 180-350 71-160</td></tr> <tr><td>440</td><td>= 300-440 149-227</td></tr> </table>	°F	°C	120	= 32-120 0-49	160	= 32-160 0-71	220	= 130-220 54-104	250	= 130-250 60-121	300	= 140-300 60-149	320	= 160-320 71-160	350	= 180-350 71-160	440	= 300-440 149-227	<table border="1"> <tr><th>70C</th><td>= 0-70°C</td></tr> <tr><th>100C</th><td>= 45-100°C</td></tr> <tr><th>120C</th><td>= 50-120°C</td></tr> <tr><th>140C</th><td>= 60-140°C</td></tr> <tr><th>160C</th><td>= 70-160°C</td></tr> </table>	70C	= 0-70°C	100C	= 45-100°C	120C	= 50-120°C	140C	= 60-140°C	160C	= 70-160°C
Pressure (20BPG) Dual scale (psi/kPa)	Pressure (20BPG) Single scale (bar)	Vacuum (20BVG) Dual scale (in. Hg/kPa)	Temperature (20BTG) Dual scale (°F/°C)	Temperature (20BTG) Single scale (°C)																																																																																
<table border="1"> <tr><th>psi</th><th>kPa/MPa</th></tr> <tr><td>15</td><td>= 0-15 0-103</td></tr> <tr><td>30</td><td>= 0-30 0-207</td></tr> <tr><td>50</td><td>= 0-50 0-345</td></tr> <tr><td>75</td><td>= 0-75 0-517</td></tr> <tr><td>100</td><td>= 0-100 0-689</td></tr> <tr><td>150</td><td>= 0-150 0-1.03</td></tr> <tr><td>200</td><td>= 0-200 0-1.38</td></tr> <tr><td>300</td><td>= 0-300 0-2.07</td></tr> <tr><td>400</td><td>= 0-400 0-2.76</td></tr> </table>	psi	kPa/MPa	15	= 0-15 0-103	30	= 0-30 0-207	50	= 0-50 0-345	75	= 0-75 0-517	100	= 0-100 0-689	150	= 0-150 0-1.03	200	= 0-200 0-1.38	300	= 0-300 0-2.07	400	= 0-400 0-2.76	<table border="1"> <tr><th>1B</th><td>= 0-1 bar</td></tr> <tr><th>2B</th><td>= 0-2 bar</td></tr> <tr><th>3.5B</th><td>= 0-3.5 bar</td></tr> <tr><th>5B</th><td>= 0-5 bar</td></tr> <tr><th>7B</th><td>= 0-7 bar</td></tr> <tr><th>10B</th><td>= 0-10 bar</td></tr> <tr><th>14B</th><td>= 0-14 bar</td></tr> <tr><th>20B</th><td>= 0-20 bar</td></tr> <tr><th>28B</th><td>= 0-28 bar</td></tr> </table>	1B	= 0-1 bar	2B	= 0-2 bar	3.5B	= 0-3.5 bar	5B	= 0-5 bar	7B	= 0-7 bar	10B	= 0-10 bar	14B	= 0-14 bar	20B	= 0-20 bar	28B	= 0-28 bar	<table border="1"> <tr><th>in. Hg</th><th>kPa</th></tr> <tr><td>20</td><td>= 0 to 20 0 to -68</td></tr> <tr><td>30</td><td>= 0 to 30 0 to -102</td></tr> </table>	in. Hg	kPa	20	= 0 to 20 0 to -68	30	= 0 to 30 0 to -102	<table border="1"> <tr><th>°F</th><th>°C</th></tr> <tr><td>120</td><td>= 32-120 0-49</td></tr> <tr><td>160</td><td>= 32-160 0-71</td></tr> <tr><td>220</td><td>= 130-220 54-104</td></tr> <tr><td>250</td><td>= 130-250 60-121</td></tr> <tr><td>300</td><td>= 140-300 60-149</td></tr> <tr><td>320</td><td>= 160-320 71-160</td></tr> <tr><td>350</td><td>= 180-350 71-160</td></tr> <tr><td>440</td><td>= 300-440 149-227</td></tr> </table>	°F	°C	120	= 32-120 0-49	160	= 32-160 0-71	220	= 130-220 54-104	250	= 130-250 60-121	300	= 140-300 60-149	320	= 160-320 71-160	350	= 180-350 71-160	440	= 300-440 149-227	<table border="1"> <tr><th>70C</th><td>= 0-70°C</td></tr> <tr><th>100C</th><td>= 45-100°C</td></tr> <tr><th>120C</th><td>= 50-120°C</td></tr> <tr><th>140C</th><td>= 60-140°C</td></tr> <tr><th>160C</th><td>= 70-160°C</td></tr> </table>	70C	= 0-70°C	100C	= 45-100°C	120C	= 50-120°C	140C	= 60-140°C	160C	= 70-160°C								
psi	kPa/MPa																																																																																			
15	= 0-15 0-103																																																																																			
30	= 0-30 0-207																																																																																			
50	= 0-50 0-345																																																																																			
75	= 0-75 0-517																																																																																			
100	= 0-100 0-689																																																																																			
150	= 0-150 0-1.03																																																																																			
200	= 0-200 0-1.38																																																																																			
300	= 0-300 0-2.07																																																																																			
400	= 0-400 0-2.76																																																																																			
1B	= 0-1 bar																																																																																			
2B	= 0-2 bar																																																																																			
3.5B	= 0-3.5 bar																																																																																			
5B	= 0-5 bar																																																																																			
7B	= 0-7 bar																																																																																			
10B	= 0-10 bar																																																																																			
14B	= 0-14 bar																																																																																			
20B	= 0-20 bar																																																																																			
28B	= 0-28 bar																																																																																			
in. Hg	kPa																																																																																			
20	= 0 to 20 0 to -68																																																																																			
30	= 0 to 30 0 to -102																																																																																			
°F	°C																																																																																			
120	= 32-120 0-49																																																																																			
160	= 32-160 0-71																																																																																			
220	= 130-220 54-104																																																																																			
250	= 130-250 60-121																																																																																			
300	= 140-300 60-149																																																																																			
320	= 160-320 71-160																																																																																			
350	= 180-350 71-160																																																																																			
440	= 300-440 149-227																																																																																			
70C	= 0-70°C																																																																																			
100C	= 45-100°C																																																																																			
120C	= 50-120°C																																																																																			
140C	= 60-140°C																																																																																			
160C	= 70-160°C																																																																																			

††Consult factory for availability of dials other than psi/kPa or °F/°C. Select scale so your normal operating value is in the middle half of the scale.

In order to consistently bring you the highest quality, full featured products, we reserve the right to change our specifications and designs at any time.

FRANK W. MURPHY MANUFACTURER P.O. Box 470248; Tulsa, Oklahoma 74147; USA tel. (918) 627-3550 fax (918) 664-6146 e-mail sales@fwmurphy.com http://www.fwmurphy.com



■ FRANK W. MURPHY MFR.—Control Systems & Services  
 P.O. Box 1819; Rosenberg, Texas 77471; USA  
 tel. (281) 342-0297 fax (281) 341-6006  
 e-mail sales@fwmurphy.com

■ FRANK W. MURPHY, LTD.  
 Church Rd.; Laverstock, Salisbury SP1 1QZ; U.K.  
 tel. +44 1722 410055 fax +44 1722 410088  
 e-mail sales@fwmurphy.co.uk  
 http://www.fwmurphy.co.uk

■ FRANK W. MURPHY FRANCE  
 tel. +33 1 30 762626 fax +33 1 30 763989

■ MURPHY DE MEXICO, S.A. DE C.V.  
 Blvd. Antonio Rocha Cordero 300, Fracción del Aguaje  
 San Luis Potosí, S.L.P.; México 78384  
 tel. +52-48-206264 fax +52-48-206336  
 e-mail ventas@murphymex.com.mx

■ FRANK W. MURPHY PTE., LTD.  
 No. 2 Tuas South Street 2,  
 Sprintecs Bldg., #02-01/02  
 Singapore 638042  
 tel. +65 863-1398 fax +65 863-0208  
 e-mail fwmurphy@fwmurphy.com.sg

■ MURPHY SWITCH OF CALIFORNIA  
 41343 12th Street West  
 Palmdale, California 93551-1442; USA  
 tel. (661) 272-4700 fax (661) 947-7570  
 e-mail sales@murphyswitch.com  
 http://www.murphyswitch.com

■ MACQUARRIE CORPORATION  
 1620 Hume Highway;  
 Campbellfield, Vic 3061; Australia  
 tel. +61 3 9358-5555 fax +61 3 9358-5558  
 e-mail murphy@macquarrie.com.au



USA-ISO 9001 FM 28221  
 UK-ISO 9002 FM 29422  
 Printed in U.S.A.